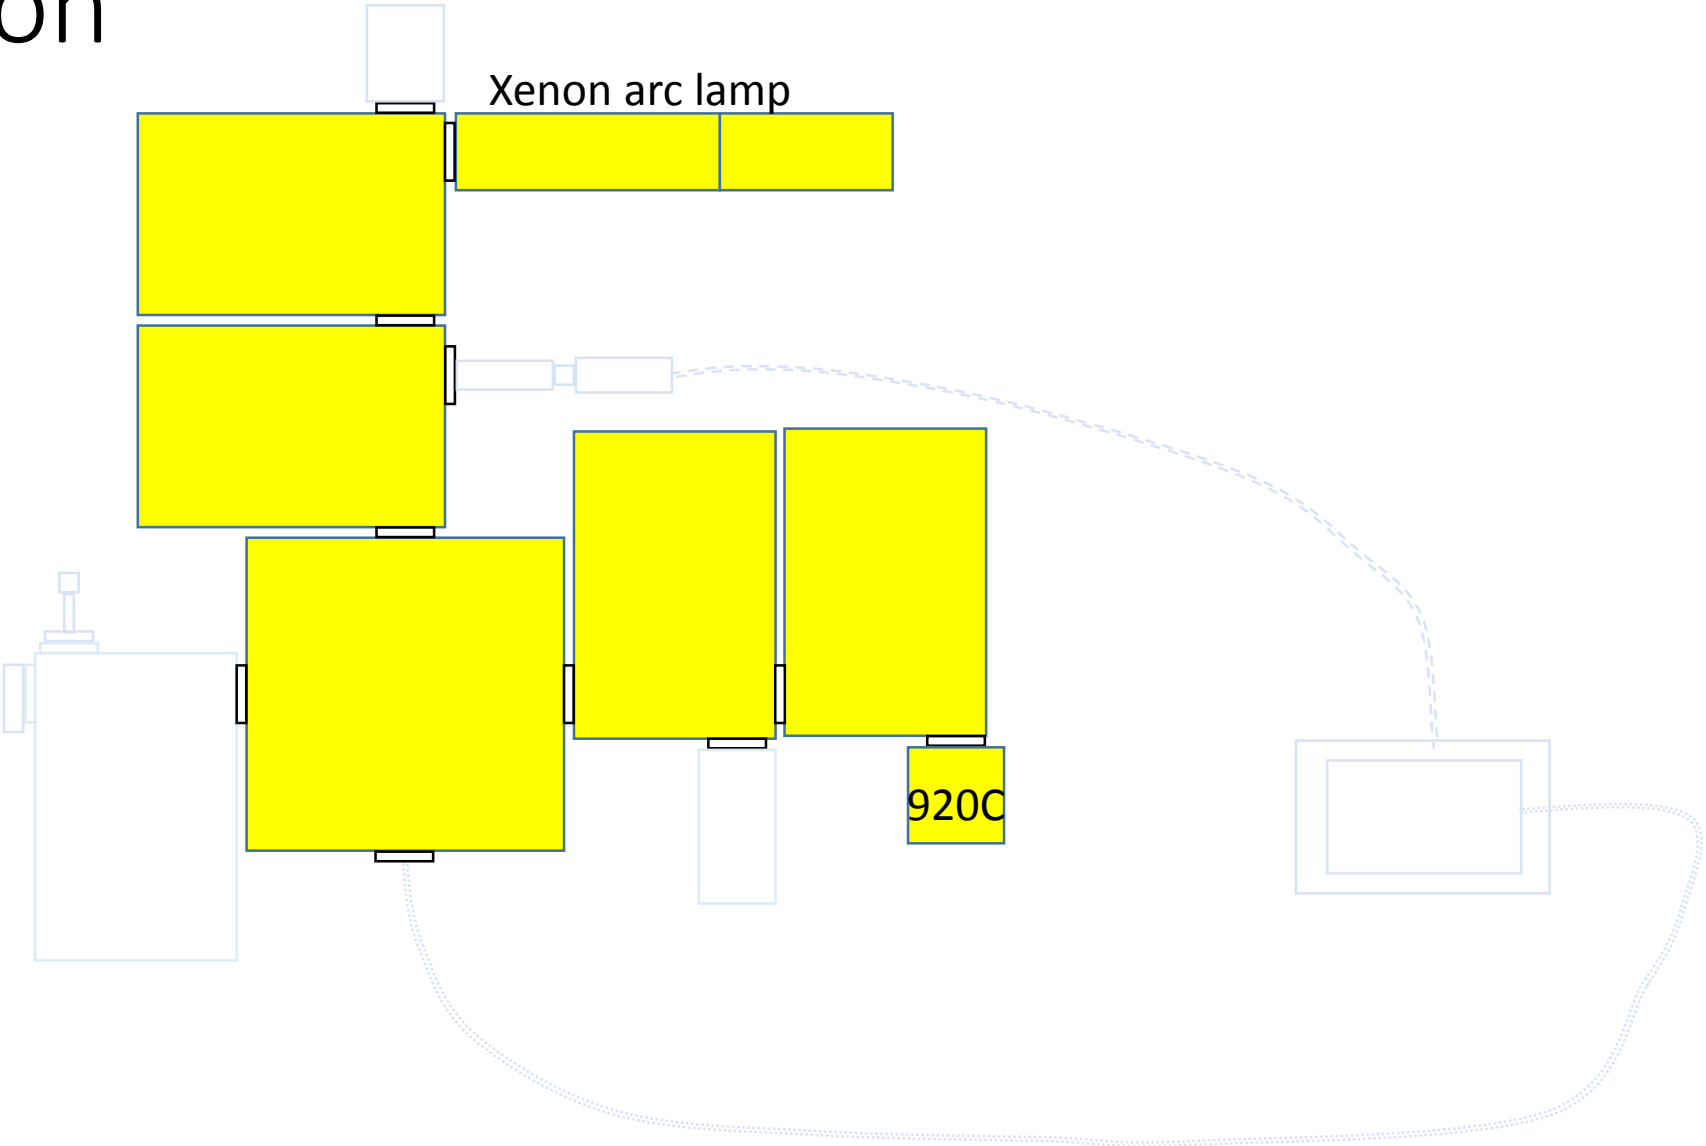# 920C Instruction

920C Instruction

Xenon arc lamp
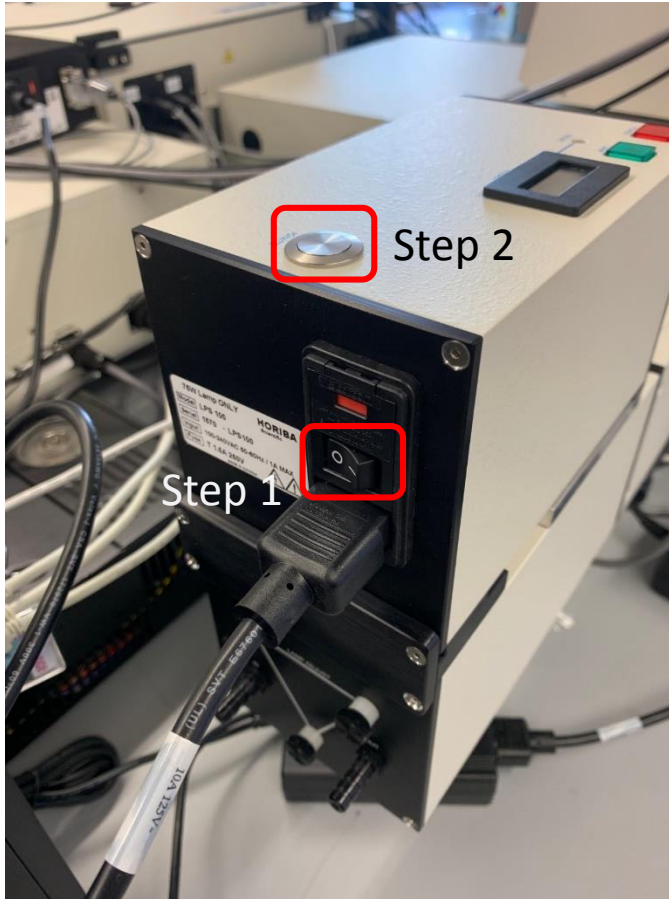
920C

Turn on the power strip under the bench
Three power strips are under the bench. Only
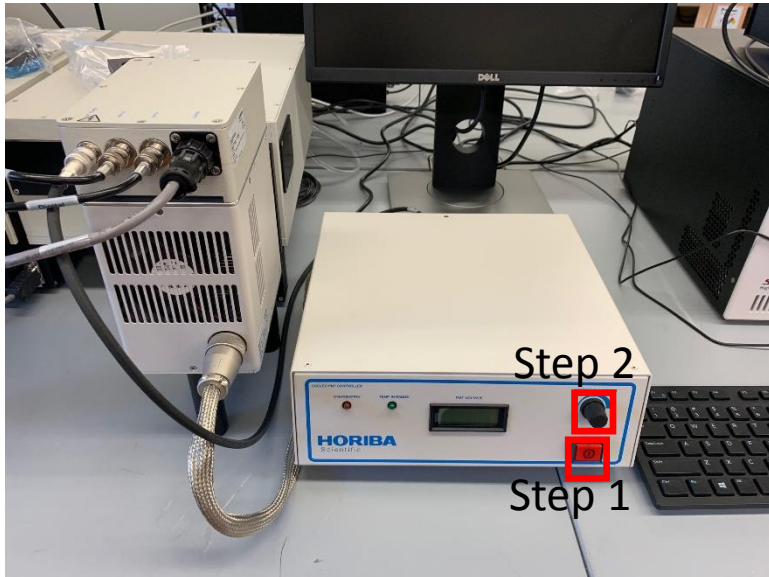one is not on. Turn that one on

Turn on the Xeon Arc Lamp

Step 1 Turn on the Power
"Power" light indicator is on
Step 2 Ignite the lamp
"Lamp" light indicator is on

Turn on the 920C PMT detector

Step1 : Turn on the power supply box by pressing the button

Step2 : Adjust voltage to 1100!!